

33/35 & 98/99


VON DUPRIN

911390-00

End Cap Retrofit Kit Installation Instructions

PARTS LIST









#10-16 X 3/8"

T-CUT SCREW

#10-24 X 1-1/8" MTG. SCREW


#10-24 X 3/4" MTG. SCREW

END CAP


END CAP MOUNTING BRACKET

ANTI-RATTLE CLIP


REMOVE OLD END CAP AND END CAP MOUNTING BRACKET.

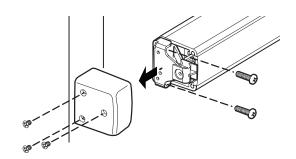


2 REMOVE OLD ANTI-RATTLE CLIP.

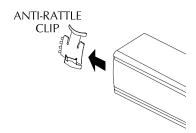


3 INSTALL NEW ANTI-RATTLE CLIP.

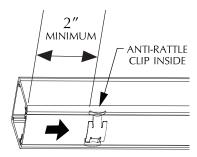

INSTALL NEW MOUNTING BRACKET AND END CAP.

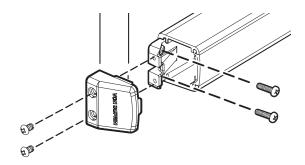

VERIFY ALL EDGES ARE ALIGNED PROPERLY AND ARE FREE OF BURRS.

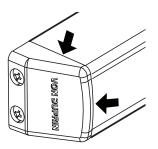




NOTE


IF DEVICE HAS BEEN CUT TO FIT DOOR, CUT MUST BE **SQUARE** FOR PROPER END CAP FIT. IF DEVICE HAS NOT BEEN CUT SQUARE, IT MAY BE NECESSARY TO REMOVE DEVICE FROM DOOR AND MAKE A CLEAN CUT FOR PROPER END CAP ALIGNMENT.

If New End Cap has a Gap as Shown Below (A):


The following method can be used to help correct it. This method works on 98/99 series devices.

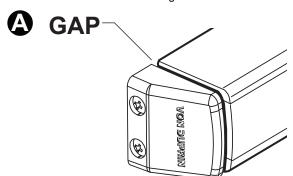


B REMOVE END CAP AND LOOSEN TWO END CAP MOUNTING BRACKET SCREWS.

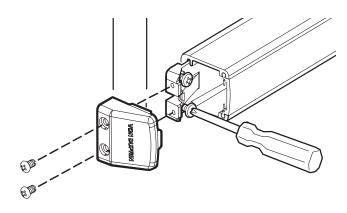


REMOVE CENTER CASE COVER AND LOOSEN TWO MECHANISM CASE SCREWS. SLIDE CASE TOWARD END CAP AS SHOWN.

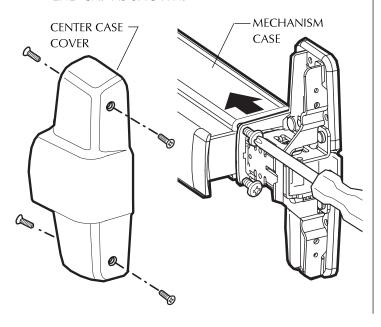


SLIDE MECHANISM CASE TOWARD END CAP BRACKET UNTIL IT STOPS AGAINST BRACKET. TIGHTEN TWO SCREWS.

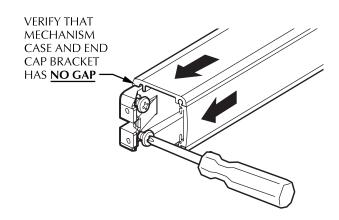

REINSTALL END CAP AND VERIFY THAT GAP IS CLOSED AND ALL EDGES ARE FLUSH.

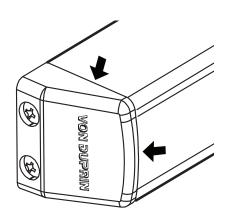

TIGHTEN TWO MECHANISM CASE SCREWS AND REINSTALL CENTER CASE COVER.

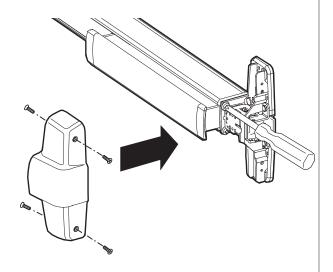

Customer Service

1-877-671-7011 www.allegion.com/us



© Allegion 2014 Printed in U.S.A. 911390-00 Rev. 01/14-b