### II - E1500-4

# **EXIT DEVICE INSTALLATION INSTRUCTIONS**

SWITCH MONITORS EGRESS BY PUSHBAR ACTIVATION OF EXIT DEVICE FOR USE WITH K-109 SWITCH KIT, CORBIN RUSSWIN ED4000, ED5000 AND YALE 7000 SERIES EXIT DEVICES

## **ELECTRICAL SPECIFICATIONS**

- SPDT MONITOR SWITCH
- CONTACT RATING: 4 AMP @ 250VAC


POSITION SWTCH KIT K-109 ON THIS SIDE OF EXIT DEVICE ONLY.

### **COLOR CODE FOR WIRES**

- YELLOW WIRE: COMMON
- RED WIRE: NORMALLY OPEN
- GRAY WIRE: NORMALLY CLOSED
- WIRE GUAGE: #22 AWG

# INSTALLATION INSTRUCTIONS

STEP 1: REMOVE REAR COVER AND BOTTOM CHANNEL COVER.
STEP 2: LOCATE EXPOSED REAR CRASH BAR MECHANISM.
STEP 3: REMOVE SCREW INDICATED IN ILLUSTRATION
FROM BOTTOM OF DEVICE AND DISCARD.
STEP 4: POSITION SWITCH BRACKET AS SHOWN AND
REPLACEWITH SCREW THAT IS PROVIDED.
STEP 5: MODIFY REAR BLACK END CAP COVER AS SHOWN.
STEP 6: REPLACE BOTTOM CHANNEL, COVER AND REAR END CAP.

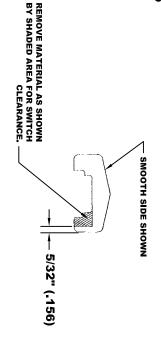



NOTES: 1.) USE MANUFACTURERS TEMPLATING FOR DOOR PREPARATION. INSTRUCTIONS PROVIDED AS SHOWN FOR SWITCH KIT MODIFICATION MODEL K-109